

Camera group/camera name	Possible cause
Cameras in Groups I to VI (except F70-Series/N70)	In the TTL auto flash mode, the SB-80DX is not properly attached to the camera body.
Cameras in Groups V and VI	In the TTL auto flash mode, the ISO film speed set on the camera is higher than the available range of the Speedlight. • The ISO film speed set on the camera is higher or lower than the available range for the FA camera only.
Cameras in Group VI	In the TTL auto flash mode, the shutter speed is set to M90, M250, or B (bulb).
FM3A, New FM2	The shutter speed set is faster than the flash sync speed.
New FM2, F55/N55	The SB-80DX's flash mode is set to TTL auto flash.

